

Can-Am Steering Issue After Speaker Install


The following fix is for steering wheel pulling to the Left or Right after installing dash mount speaker kit. This must be done by an authorized dealer or Can-Am repair center.

TORQUE OFFSET RESET

When replacing the following parts or **adjusting** steering alignment, the sensor torque offset must be reset to zero) for proper system operation.

NOTE: This must be done after the speaker is installed.

1. Ensure proper STEERING ALIGNMENT to appropriate Shop Manual subsection.
 2. Connect vehicle to the latest B.U.D.S. software.
 3. In B.U.D.S., select Read Data.
 4. Choose the Setting tab.
 5. At the bottom LH corner of the setting page, choose the DPS tab.
- NOTE: Ensure wheel is free and centered within ± 10 degrees of center position. There MUST NOT be any effort applied to the steering column.**
6. Press Reset Torque Offset button.

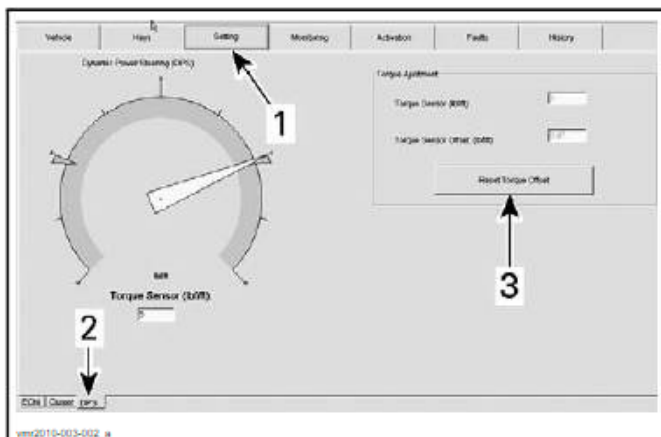

DPS TORQUE OFFSET RESET

1. Setting page tab
2. DPS tab
3. Reset Torque Offset button